
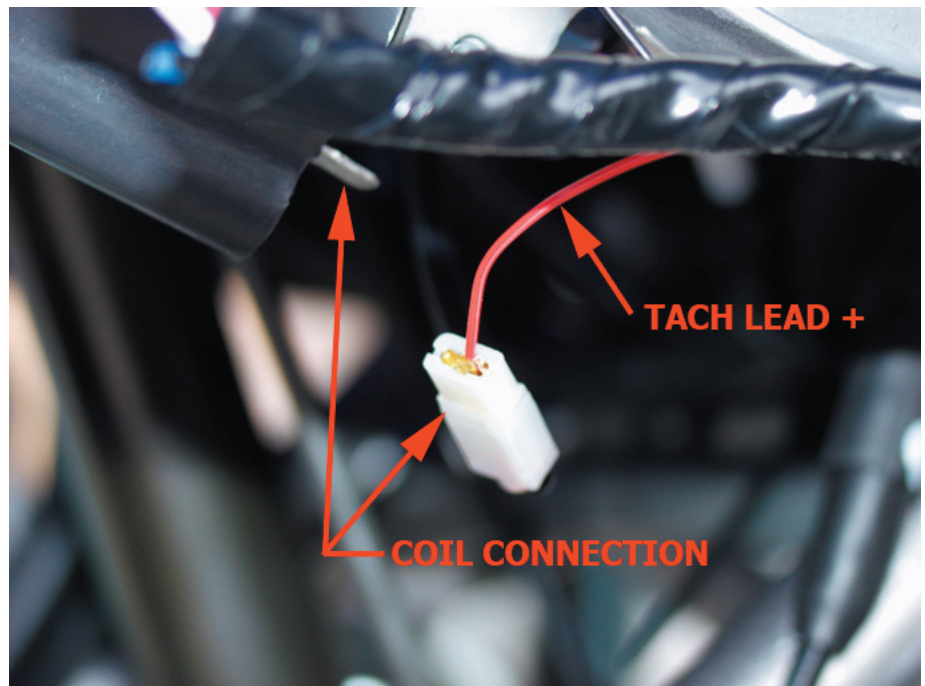


VAPOR LOW VOLTAGE TACHOMETER SENSOR INSTALLATION

LOW VOLTAGE TACHOMETER SENSOR INSTALLATION:

1. Remove the Coil Input spade connector from the coil.
2. Replace the coil input spade connector, crimping the positive tach+ lead in between the coil spade and coil input connector.
3. Connect negative tach- lead to the frame ground.

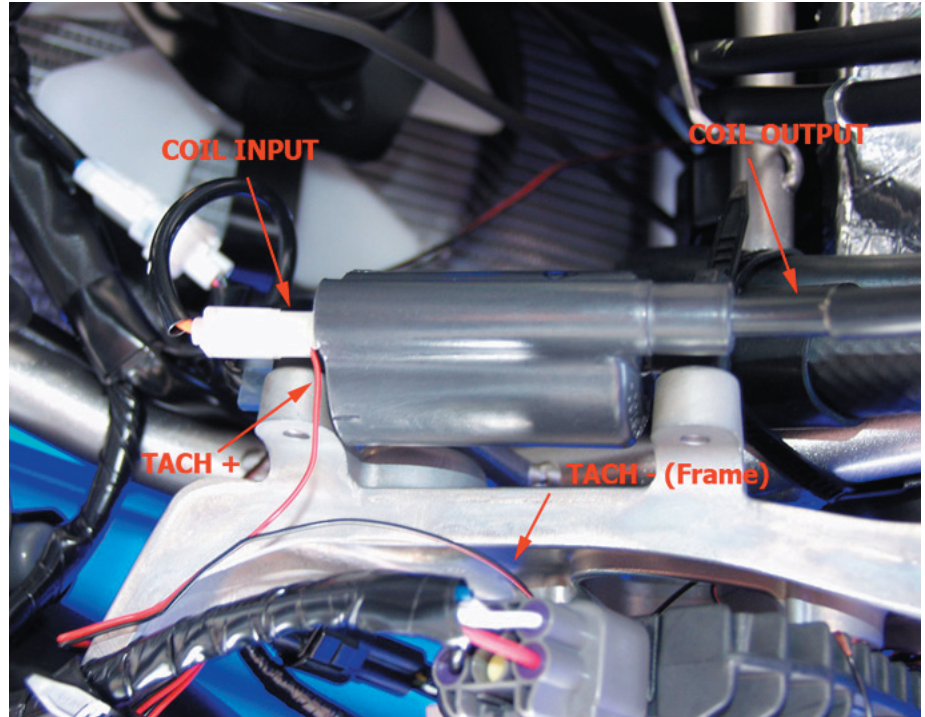

LIMITED WARRANTY

TRAIL TECH INC. WARRANTS TRAIL TECH PRODUCTS TO BE FREE FROM DEFECTS IN MATERIAL AND WORKMANSHIP UNDER NORMAL USE AND IF PROPERLY INSTALLED FOR A PERIOD OF SIX MONTHS FROM DATE OF PURCHASE. IF FOUND TO BE DEFECTIVE AS MENTIONED ABOVE, IT WILL BE REPLACED OR REPAIRED. THIS SHALL CONSTITUTE THE SOLE REMEDY OF THE PURCHASER AND THE SOLE LIABILITY OF TRAILTECH INC. TO THE EXTENT PERMITTED BY LAW, THE FOREGOING IS EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES OR REPRESENTATIONS WHETHER EXPRESSED OR IMPLIED, INCLUDED ANY LIMITED WARRANTY OF MERCHANTABILITY OR FITNESS. IN NO EVENT SHALL TRAILTECH INC. BE LIABLE FOR SPECIAL OR CONSEQUENTIAL DAMAGES.